



OEM-1

Interfacing Information Bulletin **Number 2**

March 31,1998

Vehicles: 1996 and newer Ford and L/M cars and trucks with Premium Sound or JBL audio systems.

Product: AMP-FDR2, OEM-1, any aftermarket head unit cable.

Symptom: When replacing the factory head unit the rear speakers may not work. Front speakers work fine.

Correction: Locate the black plug of the AMP-FDR2 cable and hold it with the locking tab up and looking at the wire side of the connector. The gray and purple wires should be on top. Use a paper clip to release and remove the purple wire and insert it into the housing 4 cavities to the left of its starting position. Repeat this removal and replacement procedure for the purple/ black, green and green/ black wires. All four wires move 4 cavities to the left.

Cause: Some vehicle harnesses are wired with the rear speaker wires in a different configuration.