



OEM-1

Interfacing Information Bulletin **Number 8**

September 1, 1998

Vehicles: All

Product: All aftermarket head unit cables

Symptom: No amplifier turn on voltage supplied to vehicle amplifiers from the OEM-1 interface system.

Correction: Connect the blue/white and blue wires together in the new head unit cable. These wires are in cavities 2 and 4 of the 18 pin Molex connector that plugs to the input side of the OEM-1 interface.

Cause: Some head units only provide an antenna trigger output and not a amplifier trigger, or turn on output. If you're new head unit has only the one trigger output than connecting the wires together as explained above will provide a turn on trigger to both your antenna and vehicle amplifiers.