



OEM-1

Interfacing Information Bulletin **Number 9**

April 19, 1999

Vehicles: Early 1990's Honda

Product: AMP-HON, OEM-1, any aftermarket head unit cable.

Symptom: When replacing the factory head unit only one speaker works.

Correction: On the AMP-HON cable, connect the white/black, gray/black, green/black and purple/black wires together. This will "common" all of the audio returns together.

Cause: Some of the early Honda's with the Bose system used only one common audio return for all four channels. The vehicle harness will have one wire that matches up with the negative audio wires in the AMP-HON cable thus, only one channel will work. Connecting all of the audio negatives together on the AMP-HON cable will give all four channels an audio return.