



Steering Wheel Radio Controls

Interfacing Information Bulletin **Number 2**

November 19, 1999

Product: SWI-2

Vehicles: 2000 Chevrolet Impala & Monte Carlo

Problem: Locating the correct wire in which to connect the SWI- 2. Normal methods described in the instruction for the SWI-2 to find the wire will not work.

Cause: The factory radio supplies the voltage to the steering wheel buttons instead of the buttons being supplied directly from the vehicle harness. Therefore when the factory radio is removed there is no voltage supplied to the steering wheel buttons.

Correction: In the radio plug/ harness removed from the factory radio there is a pink wire with a blue wire next to it. Connect the pink wire to switched 12 volts, and the blue wire, to the green wire of the SWI-2.
Follow normal programming of the SWI-2 as described in the instructions.