



## Steering Wheel Control Interfacing Bulletin Number 5

4-21-1999

**Symptom:** Heater control function buttons on the steering wheel do not operate properly after the SWI-2 is installed. The buttons may work, but perform different functions than before installation of the SWI-2.

**Vehicles:** All 1996-1999 Cadillac models, except Catara.

**Correction:** After the SWI-2 has been programmed and confirmed to operate the new stereo, a resistor must be removed from the circuit board.

Use a heat gun to warm and soften the hot melt glue used to hold the end caps onto the case. **Remove the cap opposite the end where the wires exit first.** After the cap is removed use your thumb and press the circuit board out of the case along with the cap where the wires exit. Be careful to push the board straight out and not to bend the red LEDs. Position the board with the wires to your left and locate the "program" push button and a 560 ohm resistor on the right of the button. Use small wire cutters and remove the 560 ohm resistor. (resistor colors are green, blue, brown)  
Reassemble the SWI-2 being careful not to bend the red LEDs. The SWI-2 must be "reprogrammed" with the new stereo's remote after removing the resistor.